


# State of Nebraska



## Pavement Quality Indicator Test

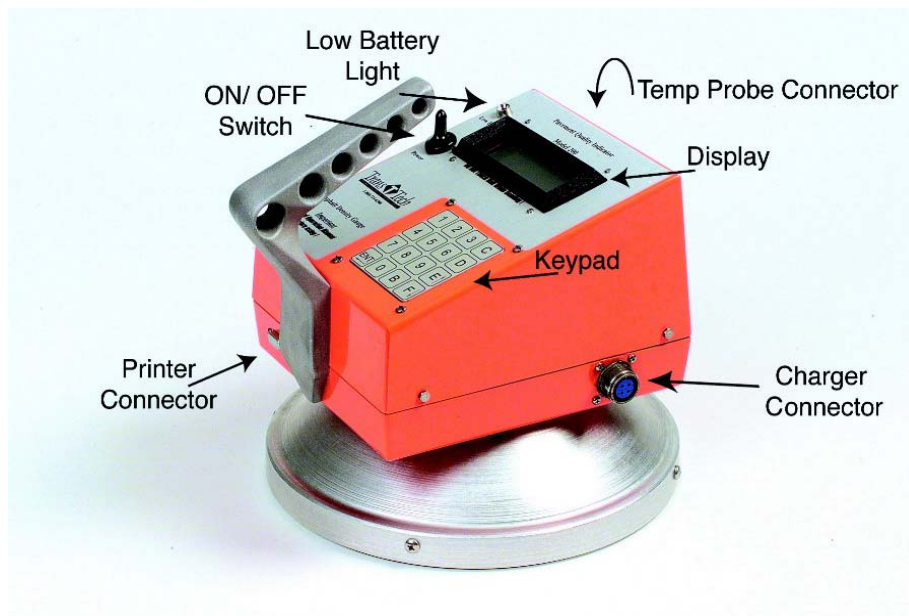

Operator  
Sylvia Hilderbrand  
Project: F-385-3 (1009)

State of NE	PQI Test	Project : F-385-3 (1009)
Operator	Sylvia Hilderbrand	

Station ID	PQI	Core	Temp	PQI vs Core Dif
1159+55 Rt, 6'	145.5	145.5	146.1	0.0
1233+41 Lt, 7'	142.9	142.8	137.2	0.1
1218+31 Lt SH, 1'				
1160+02 Lt, 5'	144.0	142.6	191.1	1.4
1160+02 Lt, 5'	143.9	142.6	149.1	1.3
1196+66 Lt, 4'				
1139+51 Rt, 11'	142.3	143.4	178.0	-1.1
1139+51 Rt, 11'	142.4	143.4	149.5	-1.0
1171+58 Rt, 1'	143.0	143.9	183.2	-0.9
1171+58 Rt, 1'	143.4	143.9	149.7	-0.5
1225+78 LtSh, 5'	144.2	142.7	140.1	1.5
1252+67 Lt, 2'	144.2	145.8	165.8	-1.6
1276+23 Lt, 10'	143.6	143.7	165.5	-0.1
1276+23 Lt, 10'	143.9	143.7	141.3	0.2
1314+74 Lt, 4"	143.1	142.3	168.4	0.8
1314+74 Lt, 4"	142.6	142.3	134.1	0.3
1358+74 Lt, 4'	144.5	144.5	142.6	0.0
1358+74 Lt, 4'	144.6	144.5	132.2	0.1
1218+99 Rt, 1'	141.6	143.4	151.7	-1.8
1218+99 Rt, 1'	141.6	143.4	137.0	-1.8
1246+14 Rt, 9'	142.1	143.3	173.7	-1.2
1246+14 Rt, 9'	142.7	143.3	130.8	-0.6
1287+22 Rt, 6'	144.3	146.8	159.2	-2.5
1317+79 Rt, 8'	143.6	144.0	147.1	-0.4
1317+79 Rt, 8'	143.5	144.0	129.3	-0.5
1365+03 Rt, 5'	144.4	145.0	160.7	-0.6
1365+03 Rt, 5'	144.3	145.0	142.0	-0.7
1122+51 Rt, 7'	145.1	143.0	149.1	2.1
1099+19 Rt, 11'	143.7	143.3	126.7	0.4
1099+19 Rt, 11'	144.3	143.3	51.1	1.0
1115+61 Lt, 8'	145.2	145.3	106.3	-0.1
1094+72 Lt, 7	146.7	145.1	60.7	1.6
1094+72 Lt, 8	145.2	145.1	134.7	0.1
897+16 Rt, 6'	144.5	143.1	128.0	1.4
881+41 Lt, 1'				
840+70 Lt, 6'	145.4	145.9	155.4	-0.5
1188+09 Rt, 0'	143.6	142.3	93.5	1.3
1396+10 Lt 7'	144.2	143.4	142.8	0.8
1376+10 Rt, 4'	144.7	142.9	106.3	1.8
1053+02 Lt, 5'	144.5	142.8	129.3	1.7
945+95 Lt, 9'	142.8	140.2	113.3	2.6
893+06 Lt, 3'	143.7	140.7	123.2	3.0
1104+04 Lt Sh	143.3	143.3	91.2	0.0
1028+65 Lt Sh	143.5	142.7	112.9	0.8
894+01 Rt Sh	144.2	142.7	120.0	1.5
<b>Average</b>	<b>143.8</b>	<b>143.6</b>		

<b>ST Div</b>	<b>1.1</b>	<b>1.3</b>
---------------	------------	------------